



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D119-646-243
Job Sheet 187553



Part No: D119-646-243

Job Qty: 1 ea

Part Name: AW119 Repl. Skidtube with Heavy Duty Wearplates, Float Compatible -Fits LH or RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 12/7/18

Job Tracking No:

Due Date: 1/25/19

Created By: Jesse White

Type: Stock

Description:

Note: IIN-D119-646 REV D, D3905-045 REV.F IPP RevA: New issue DD verified by:EC IPP REV.B 12.11.05 (DEOD3905-B-1)(ecn 12-675) DD verf:JLM IPP REV:C 13.03.20 per chg003 ECN13-534 DD verf:JLM IPP REV:D 15.01.19 AS PER ECN-14-628 DD verf:JLM IPP REV:E 16.11.02 chg as per D3905 revD(DEO) DD verf:JLM IPP REV:F 17.05.19 as per dwg D3905 rev.e DD verf:JFS

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		1/25/19	0.00	0.00	Start Up Skid tubes-1		MCG
110	Skid tubes	1 pcs		1/25/19	0.00	2.07	Skid tubes-1		MCG
120	HandFinish	1 pcs		1/25/19	0.00	1.05	HandFinish1		D.R. 18/12/12
130	QC	1 pcs		1/25/19	0.00	0.00	QC7-1		MCG
150	Skid tubes	1 pcs		1/25/19	0.00	2.07	Skid tubes-1		ly
155	CNC Bend Skid tubes	1 pcs		1/25/19	0.00	1.20	CNC Bend Skid tube		MCG
165	QC	1 pcs		1/25/19	0.00	0.00	QC5		BE
180	Skid tubes	1 pcs		1/25/19	0.00	2.07	Skid tubes-1		BE
190	QC	1 pcs		1/25/19	0.00	0.00	QC5		BE
200	CNC Bend Skid tubes	1 pcs		1/25/19	0.00	1.20	CNC Bend Skid tube		MCG
210	Skid tubes	1 pcs		1/25/19	0.00	1.41	Skid tubes-1		MCG
220	QC	1 pcs		1/25/19	0.00	0.00	QC5		BE
224	Skid tubes	1 pcs		1/25/19	0.00	3.70	Skid tubes-1		BE
225	QC	1 pcs		1/25/19	0.00	0.00	QC5		38 DAS
226	QC	1 pcs		1/25/19	0.00	0.00	QC10		9-88 38
227	HandFinish	1 pcs		1/25/19	0.00	1.05	HandFinish2		SA 19/01/18
240	SprayPaint	1 pcs		1/25/19	0.00	0.56	Spray Paint		AS 19-1-26
242	Outsource	1 pcs		1/25/19			ATE003-VC	5	N/R
245	QC	1 pcs		1/25/19	0.00	0.00	QC14		19-01-28
250	HandFinish	1 pcs		1/25/19	0.00	1.05	HandFinish4		19-01-28
260	QC	1 pcs		1/25/19	0.00	0.00	QC5		19-1-28
270	HandFinish	1 pcs		1/25/19	0.00	1.49	HandFinish4		19-1-28
280	QC	1 pcs		1/25/19	0.00	0.00	QC5		19-1-28
285	HandFinish	1 pcs		1/25/19	0.00	1.05	HandFinish3		19-01-28
286	QC	1 pcs		1/25/19	0.00	0.00	QC5		JAN 2 8 2019 68
288	DC	1 pcs		1/25/19	0.00	0.00	DC		DAS 9-89
290	Packaging	1 pcs		1/25/19	0.00	0.00	Packaging3-1		DAS 30
300	QC21-FG	1 Ea		1/25/19	0.00	0.00	QC21		21 9-89

Part Op 110 - 1- Inspect Mat'l D2500-1-190 for damage 2- Ensure squareness of ends

Plex 12/7/18 11:42 AM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Skid-tube ☐ Machining ☐ Large Fab ☐		DEPARTMENT/PROCESS Cross tube ☐ Small Fab ☐ Finishing ☐		Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐		Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐	
Date :		Sequence :		Qty Affected :				MRB (QSI042)	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor	
								QC / QA Coordinator	
FAULT CATEGORY Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐				Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread ☐					

Descriptions: 120 - Chemical Conversion Coat per QSI005 4.1

130 - QC7-Inspect Chemical Conversion Coat

150 - 1- Install drill jig DT9480 drill all x-bolt spacer holes using 3/16 drill first side only. 2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes. 3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477 4- Scribe batch # inside aft end of tube

155 - 1- Bend AFT end of tube using CNC Bender 1 and bend prog. D3905 AFT as per dwg D3905. Must use bending Aid DT9538, located 23.25" from Aft end. 2- Ensure bending Aid DT9538 is positioned correctly, that the bender set up in on full wide and that the indexing ridge is covered with graphite grease.

165 - QC5- Inspect part completeness to step on W/O

180 - 1- Verify dimension of bend as per dwg D3905 2- Buff out marks left from bending. 3- Drill Aft Float bag holes using DT9493 as per dwg D3905 detail G and section F-F, open to finished size 4- Open x-bolt spacer holes to finished size as per dwg (sections D-D and E-E) ***DO NOT OPEN FWD SADDLE HOLES*** 5- Drill Aft wearplate and wearpad holes using DT9546 and DT9545 as per dwg D3905 detail G open to finished size 6- Deburr, blow out chips from inside of tube 7- Bond web in place as per Dwg D3905 & QSI 015. A/R Sikaflex-291 5130855 Sikaflex expire

date: March 2019 Start: _____ Time: _____ Finish: _____ Time: _____ ***** (Adhere for 12 hours)*****

190 - QC5- Inspect part completeness to step on W/O

200 - 1- Bend Fwd end of tube using bender 1 and bend prog. D3905 & Folio -04 Fwd. Use bending aid DT9544 ensure proper positioning 2- Cut Fwd end of tube as per dwg. ***VERIFY MEASUREMENT BEFORE CUTTING***

210 - 1- Buff out marks left from bending 2- Drill Fwd cap holes using DT8215. 3- Open Fwd saddle holes to finished size as per dwg 4- Drill Fwd x-bolt hole and open to finished size using DT9816 5- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg. 6- Drill towing hole using DT10047 locate from FWD saddle hole and open to finished size. 7- C'sink FWD cap hole as per detail "C" 10- Deburr, blow out chips from inside of tube.

220 - QC5- Inspect part completeness to step on W/O

224 - NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDLING FIXTURE, IF

FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091. 1- Countersink x-bolt holes as per dwg 2- Remove alodine prepare for welding 3- Insert x-bolt spacers 4- Weld x-bolt spacer as per dwg A/R Alum rod Batch: 138909 5- Grind welds flush as per dwg 6- Counter bore x-bolt holes as per dwg 7- Deburr 8- Pick D2855-5 cap and transfer drill missing hole. Deburr and identify cap with skid tube batch#.

225 - QC5- Inspect part completeness to step on W/O TEST FIT USING FIXTURE DT10091.

226 - QC10- Inspect visual per QSI004- ground welds

227 - Pressure Wash per QSI005 4.3

240 - Spray Painting per QSI005 4.2 *****AS PER DEO DETAIL "F" NOTE 8, SHEET 8 MASK THIS AREA, DO NOT APPLY PRIMER OR PAINT***** PRIME AS PER DWG AND QSI 005 4.2 BATCH: 138976 PAINT WHITE AS PER DWG AND QSI 005 4.2 BATCH: 514608

245 - QC14- Inspect Spray Paint

250 - Assemble as per dwg 1- Install inserts as per Dwg D3905.

260 - QC5- Inspect part completeness to step on W/O

270 - 1- Install wearpads, gaskets and wearplates as per Dwg D3905. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 14128386 Sikaflex expire date: 19-02 2- install plugs assembly as per dwg. 3- Inspect for foreign objects as per QSI 024 4- Install D2855-3 Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 14128386 Sikaflex expire date: 19-02 5- Install insert in D2855- Cap. Install cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 14128386 Sikaflex expire date: 19-02 6- Install (2) D5101-041 and (1) D5101-047 as per dwg by using DT10117 7- INSTALL PLUGS

280 - QC5- Inspect part completeness to step on W/O

285 - Wing Walk as per dwg QSI005 4.4 Batch 51309163

286 - QC5- Inspect part completeness to step on W/O

288 - Document Control Photocopy bluefile & type labels per PPP D119-646-243 CHG 006

290 - Identify as per dwg & Stock Location: _____

300 - QC21- Final Inspection - Work Order Release

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Job BOM					007769
Part / Item	Component Name	Quantity	Operation	Container	
D2500-1-190	Ext'n -1' Beam Tube 4"	1 pcs (1 ea)	90-Start up Operation	5112963	
D3885-3	Float Web	1 Ea (1 ea)	180-Skidtubes	5096476	
D2579	Crossbolt Spacer	2 pcs (2 ea)	224-Skidtubes	5051352	
D2855-5	Cap	1 pcs (1 ea)	224-Skidtubes	5002078	
D3681-1	Spacer	12 Ea (12 ea)	224-Skidtubes	5103210	
D3903-1	Spacer	12 pcs (12 ea)	224-Skidtubes	5124490 x9	5144956x3
ALS4-1032-130	Rivnut	10 Ea (10 ea)	250-HandFinish	5007279	
ALS4-1032-225	Rivnut	1 Ea (1 ea)	270-HandFinish	5058139	
AN3C46A	Bolt	4 Ea (4 ea)	270-HandFinish	5095398	
AN3C50A	Bolt	4 Ea (4 ea)	270-HandFinish	5109956	
AN3C5A	Bolt	12 Ea (12 ea)	270-HandFinish	5076999	
AN4C46A	Bolt	3 Ea (3 ea)	270-HandFinish	5100406	
D2855-3	Cap	1 pcs (1 ea)	270-HandFinish	5126402	
D3411-3	Washer	24 Ea (24 ea)	270-HandFinish	5145921	
D3672-1	Washer, Phenolic	2 Ea (2 ea)	270-HandFinish	5164008	
D3847-1	Wearpad	1 Ea (1 ea)	270-HandFinish	5133454	
D3847-11	Wearpad	1 Ea (1 ea)	270-HandFinish	5105238	
D3849-045	Aft Heavy-Duty Wearplate, Float Skid Compatible	1 Ea (1 ea)	270-HandFinish	5146277	
D3849-047	Fwd Heavy-Duty Wearplate, Float Skid Compatible	1 Ea (1 ea)	270-HandFinish	5146137	
D3904-1	Washer	16 pcs (16 ea)	270-HandFinish	5141322	
D5101-041	Crossbolt Spacer Assembly	2 Ea (2 ea)	270-HandFinish	5145321	
D5101-047	Crossbolt Spacer Assembly	1 Ea (1 ea)	270-HandFinish	5103114	
D5101-3	Insert	6 Ea (6 ea)	270-HandFinish	5143982	
D5101-5	Insert	6 Ea (6 ea)	270-HandFinish	5143974	
MS21043-3	Nut	8 Ea (8 ea)	270-HandFinish	5099569	
MS21043-4	Nut	3 Ea (3 ea)	270-HandFinish	5119223	
MS24694-C52	Screw	2 Ea (2 ea)	270-HandFinish	5067269	
NAS1149C0332R	Washer	8 Ea (8 ea)	270-HandFinish	5124666	
NAS1149D0416J	Washer	3 Ea (3 ea)	270-HandFinish	511131511	
D3492-5	Plug	8 Ea (8 ea)	270-HandFinish	5137511	
NAS1611-005	O-Ring	8 Ea (8 ea)	270-HandFinish	5057657	

007767

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2500-1-190	1	54	0
180-Skidtubes	D3885-3	1	12	0
224-Skidtubes	D2579	2	199	0
	D2855-5	1	123	0
	D3681-1	12	132	0
	D3903-1	12	81	0
250-HandFinish	ALS4-1032-130	10	10,623	0
270-HandFinish	ALS4-1032-225	1	1,280	0
	AN3C46A	4	103	0
	AN3C50A	4	173	0
	AN3C5A	12	1,492	0
	AN4C46A	3	160	0
	D2855-3	1	51	0
	D3411-3	24	42	0
	D3492-5	8	119	0
	D3672-1	2	1,399	0
	D3847-1	1	40	0
	D3847-11	1	10	0
	D3849-045	1	2	0
	D3849-047	1	1	0
	D3904-1	16	56	0
	D5101-041	2	2	0
	D5101-047	1	4	0
	D5101-3	6	9	0
	D5101-5	6	6	0
	MS21043-3	8	866	0
	MS21043-4	3	859	0
	MS24694-C52	2	120	0
	NAS1149C0332R	8	3,012	0
	NAS1149D0416J	3	2,100	0
	NAS1611-005	8	303	0

Part Specifications

Specifications could not be found.

Plex 12/7/18 11:42 AM dart.white.jesse

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

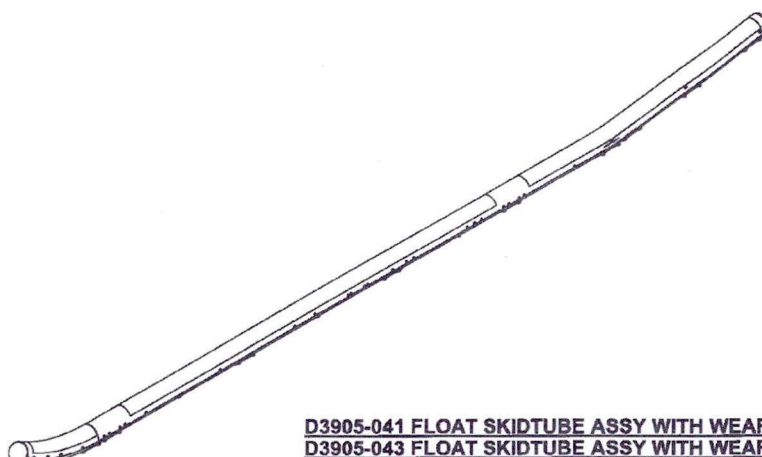

D3905-041 FLOAT SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3905-043 FLOAT SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3905-045 FLOAT SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

RELEASED

2018 OCT 19
ECN 18-709

APPROVED

F	ADDED WASHERS FOR AFT TRAINING WEARPLATE. D3411-3 QTY 24 WAS 18, REF CAR17-205. ADDED STRUCTURAL PROVISIONS TO ALLOW FOR THE INSTALLATION OF D119-046-313-314 SKIDTUBE PROTECTOR KIT. D3492-045 QTY 24 WAS 18 ON -041/-043, ADDED D3492-045 PLUGS TO -045, D3681-1 QTY 12 WAS 8 ON -051/-053. Ø0.313 HOLE QTY 12 WAS 8 ON -11/-13. Ø0.129 HOLE QTY 23 WAS 18 ON -3. REF NCR17-6586. FLAG NOTE 10 WAS 9 ON SHT 2 & 3	ZF	18.08.16
E	COMPLETE REDRAW SEE PREVIOUS REV. AFT FLOAT HOLE NOW Ø0.465 WAS Ø0.437. FINISH REMOVED FROM SADDLE AREA SEE DETAIL F. REF PART 5-421 CHANGE QTY OF D2855-3. ADDED D2855-5 CAP ASSEMBLIES. ADDED INSTRUCTIONS TO LOCATE INSERT HOLE FOR D2855-5 CAP. REF PART 17-583 ADDED DRILL JIG REF NUMBER. NCR15-5366 INCREASE RIDGE RELIEF FROM 0.060 TO 0.130. REF PART 17-574	AJS / WK	17.03.13
D	REVISED DIMENSIONS AND PROVIDED TOLERANCE TO SKIDTUBE OVERALL LENGTH PAGE 5-6 REVISED NOTE 2 AND NOTE 7 PAGE 1 (ZN B8, ZN A8-1) REVISED -041/-043/-045 DRAWING VIEWS. REVISED SECTION VIEW F-F (ZN B4-7). REVISED BOM REF. PART 3-299 AND PART 3-272	AK	14.08.08
C	(SHT 1 PL. ZN C2-2, C2-3, C2-4) ITEM 13, QTY 2 WAS 4. ITEM 42 AND 45, QTY 44 WAS 48. ADD ITEM 48, MS24694-C52 WAS ANSC5A, D3672-1 AND NAS1149C0332R, (ZN C7-7) Ø0.201 CSK Ø0.385 X 100° WAS Ø0.204 THRU, (ZN A4-5, A4-6) ADD RELIEF INSTRUCTION. ADD ITEM 10, CROSS BOLT SPACER (ZN D4-1, C6-7, D6-7)	DB	13.02.21
B	REVISED PART LIST. ALS4-1032-130 WAS AELS-1032-130 (ZN A6-5, A5-6, C5-7, C3-7, A5-7); ADD DT8932 (ZN A8-1); D2855-3 WAS D2575 (ZN C8-2, C1-2, C8-3, C1-3, C8-4, C1-4); AN305A WAS ANSC5A (ZN C7-2, C1-2, C7-3, C1-3, C7-4, C1-4); D3849-047 WAS D3849-041 (ZN B3-4); ADD D3411-3 (ZN B3-4); ADD AN305A (ZN B3-4); Ø0.313 WAS Ø0.328 (B2-5, B2-6, C2-7, A8-7 & D7-8). REVISED NOTE N (ZN A8-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 1 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND UNCLASSIFIED. AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR OFFERED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -041	P/N	DESCRIPTION
	X	D3905-041	SKIDTUBE ASSY
1	1	D2855-3	CAP
2	1	D2855-5	CAP
3	24	D3492-045	PLUG
4	2	D3672-1	PHENOLIC WASHER
5	8	D3847-1	WEARPAD
6	1	D3847-11	WEARPAD
7	1	D3905-051	SKIDTUBE SUB ASSEMBLY
8	2	D5101-041	CROSSBOLT SPACER ASSY
9	1	D5101-047	CROSSBOLT SPACER ASSY
10	6	D5101-3	INSERT
11	6	D5101-5	INSERT

ITEM	QTY -041	P/N	DESCRIPTION
12	1	ALS4-1032-225	INSERT
13	6	AN3C4A	BOLT
14	38	AN3C5A	BOLT
15	3	AN4C46A	BOLT
16	3	MS21043-4	NUT, SELF-LOCKING
17	2	MS24694-C52	SCREW, CSK 100°
18	44	NAS1149C0332R	WASHER
19	6	NAS1149C0416R	WASHER

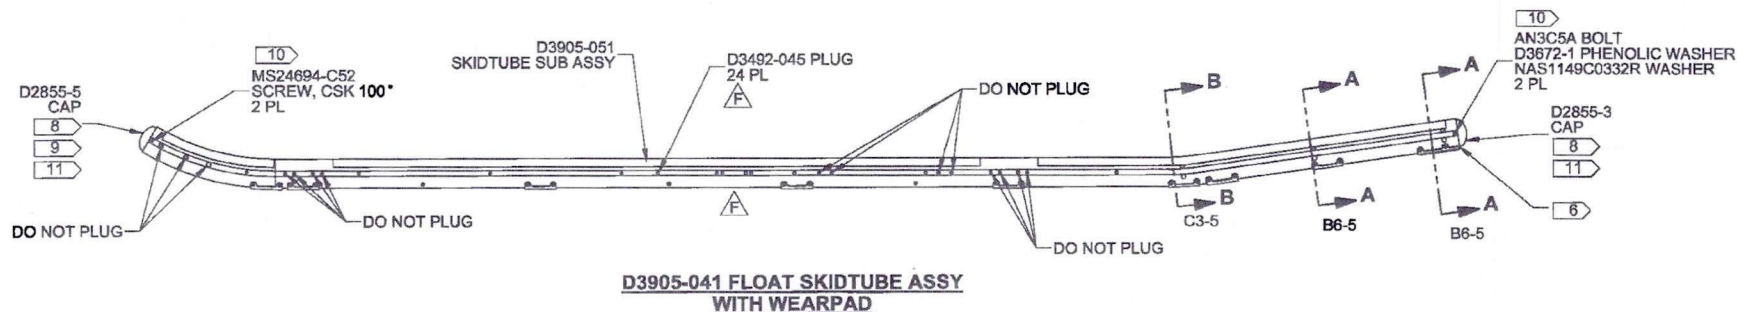

**D3905-041 FLOAT SKIDTUBE ASSY
WITH WEARPAD**

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3905-041" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 35.4 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3905-051 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP, OPEN HOLE TO $\phi 0.297$, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 2 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUBJECT TO THE FOLLOWING CONDITIONS: THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED

2018 OCT 19

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :			MRB (QSI042)
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -043	P/N	DESCRIPTION
	X	D3905-043	FLOAT SKIDTUBE ASSY
1	1	D2855-3	CAP
2	1	D2855-5	CAP
3	24	D3492-045	PLUG
4	2	D3672-1	PHENOLIC WASHER
5	1	D3847-043	FWD WEARPLATE ASSY
6	1	D3847-045	CENTER WEARPLATE ASSY
7	1	D3847-049	AFT WEARPLATE ASSY
8	8	D3847-1	WEARPAD
9	1	D3847-11	WEARPAD
10	1	D3905-051	SKIDTUBE SUB ASSEMBLY
11	2	D5101-041	CROSSBOLT SPACER ASSY
12	1	D5101-047	CROSSBOLT SPACER ASSY
13	6	D5101-3	INSERT
14	6	D5101-5	INSERT

ITEM	QTY -043	P/N	DESCRIPTION
15	1	ALS4-1032-225	INSERT
16	44	AN3C5A	BOLT
17	3	AN4C46A	BOLT
18	3	MS21043-4	NUT, SELF-LOCKING
19	2	MS24694-C52	SCREW, CSK 100"
20	44	NAS1149C0332R	WASHER
21	6	NAS1149C0416R	WASHER

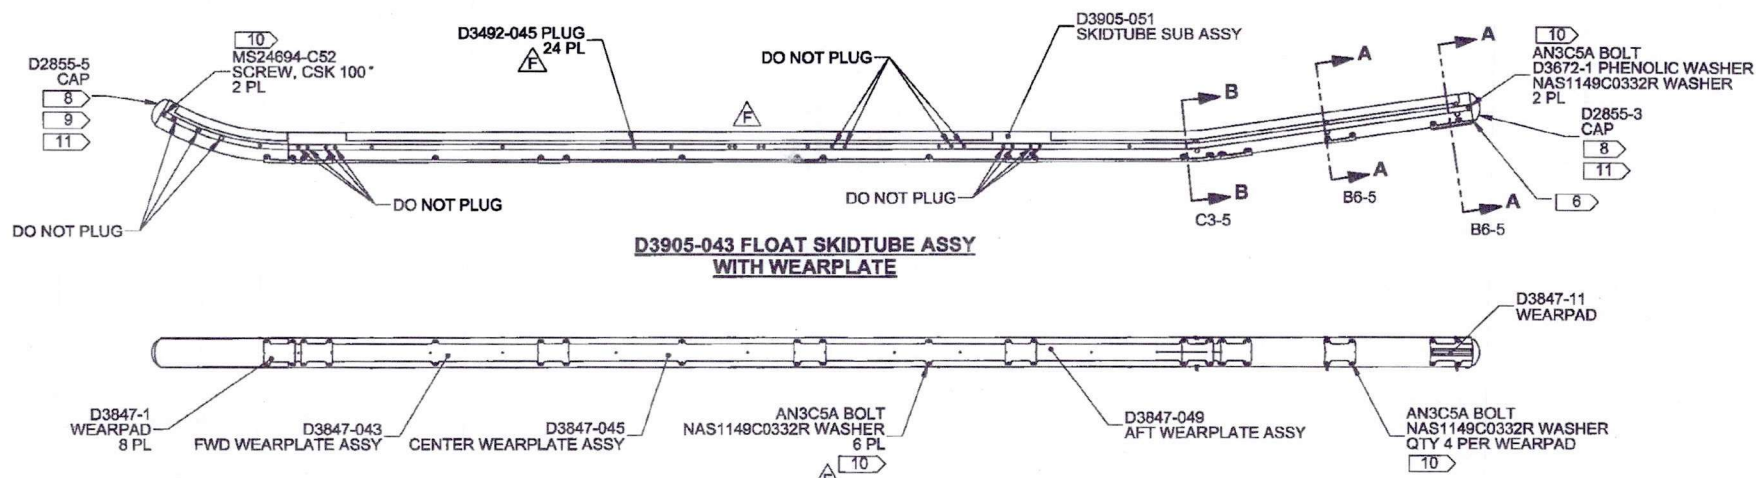

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3905-043" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 42.8 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3905-051 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP, OPEN HOLE TO $\varnothing 0.297$, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

RELEASED

2018 OCT 19

DESIGN		AJS		DART AEROSPACE USA, INC.	
DRAWN		ZF		EUGENE, OR	
CHECKED		MW		DRAWING NO.	
MFG. APPR.		DD		D3905	
APPROVED		NO		TITLE	
DE APPR.		DS		A119 FLOAT SKIDTUBE ASSY	
DATE		18.08.16		REV. F	
				SHEET 3 OF 14	
				SCALE	
				NTS	

COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL. AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -045	P/N	DESCRIPTION
	X	D3905-045	FLOAT SKIDTUBE ASSY
1	1	D2855-3	CAP
2	1	D2855-5	CAP
3	24	D3411-3	WASHER
4	2	D3672-1	PHENOLIC WASHER
5	1	D3847-1	WEARPAD
6	1	D3847-11	WEARPAD
7	1	D3849-045	AFT WEARPLATE ASSY, FLOAT GEAR
8	1	D3849-047	FWD WEARPLATE, FLOAT GEAR
9	16	D3904-1	WASHER
10	1	D3905-053	SKIDTUBE SUB ASSEMBLY
11	2	D5101-041	CROSSBOLT SPACER ASSY
12	1	D5101-047	CROSS BOLT SPACER
13	6	D5101-3	INSERT
14	6	D5101-5	INSERT

ITEM	QTY -045	P/N	DESCRIPTION
15	1	ALS4-1032-225	INSERT
16	12	AN3C5A	BOLT
17	4	AN3C46A	BOLT
18	4	AN3C50A	BOLT
19	3	AN4C46A	BOLT
20	8	MS21043-3	NUT, SELF-LOCKING
21	3	MS21043-4	NUT, SELF-LOCKING
22	2	MS24694-C52	SCREW, CSK 100°
15	12	NAS1149C0332R	WASHER
24	6	NAS1149D0416J	WASHER
25	8	D3492-045	PLUG

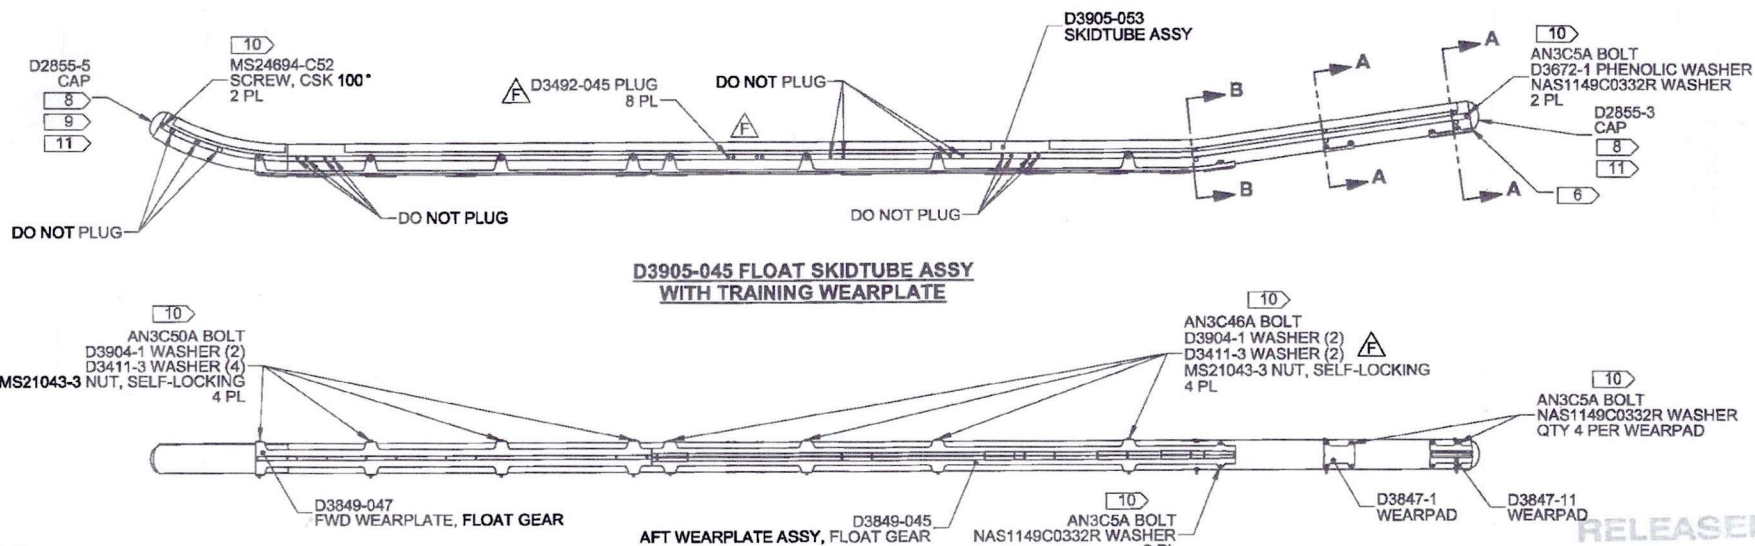

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3905-045" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 48.0 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3905-053 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP, OPEN HOLE TO $\varnothing 0.297$, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 4 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

8

7

6

5

4

3

2


1

D

C

B


A

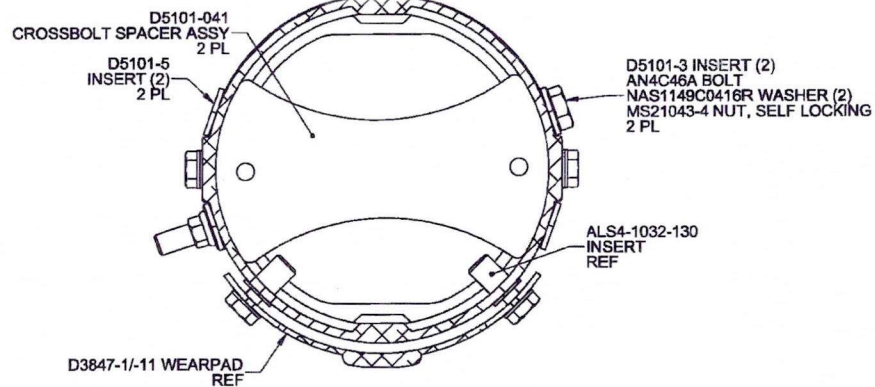

D5101-047
CROSSBOLT SPACER ASSY

D5101-5
INSERT
2 PL

D5101-3 INSERT (2)
AN4C46A BOLT
NAS1149C0416R WASHER (2)
MS21043-4 NUT, SELF LOCKING

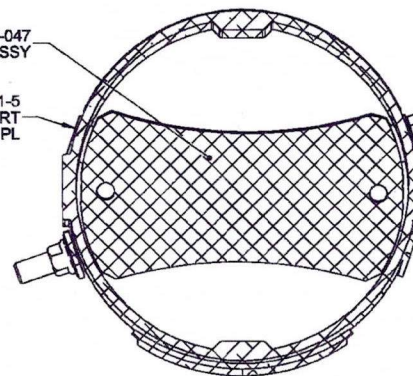

RELEASED
2018 OCT 13 4

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 5 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

8

7

6

5

4

3

2

1

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -051	P/N	DESCRIPTION
	X	D3905-051	SKIDTUBE SUB ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3681-1	SPACER
3	12	D3903-1	SPACER
4	1	D3905-061	SKIDTUBE SUB ASSEMBLY
5	42	ALS4-1032-130	INSERT

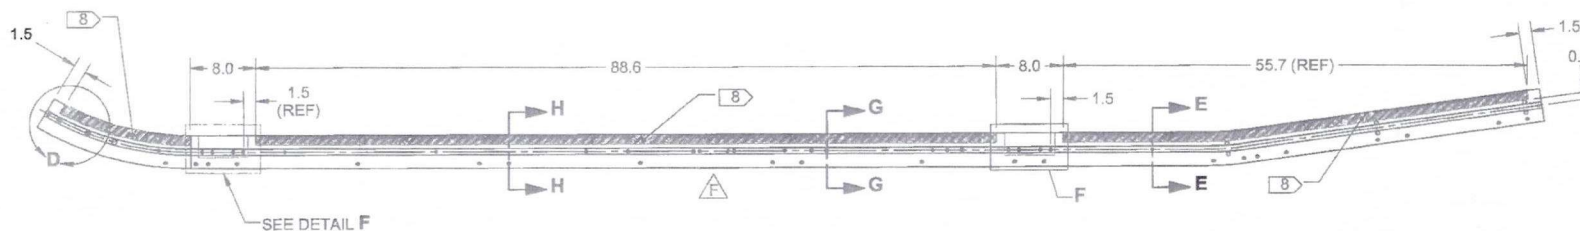

D3905-051 SKIDTUBE SUB ASSEMBLY

RELEASED
2018 OCT 19

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PRIME (REF 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2.2.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50" ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 6 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY	P/N	DESCRIPTION
	X	D3905-053	SKIDTUBE SUB ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3681-1	SPACER
3	12	D3903-1	SPACER
4	1	D3905-063	SKIDTUBE SUB ASSEMBLY
5	10	ALS4-1032-130	INSERT

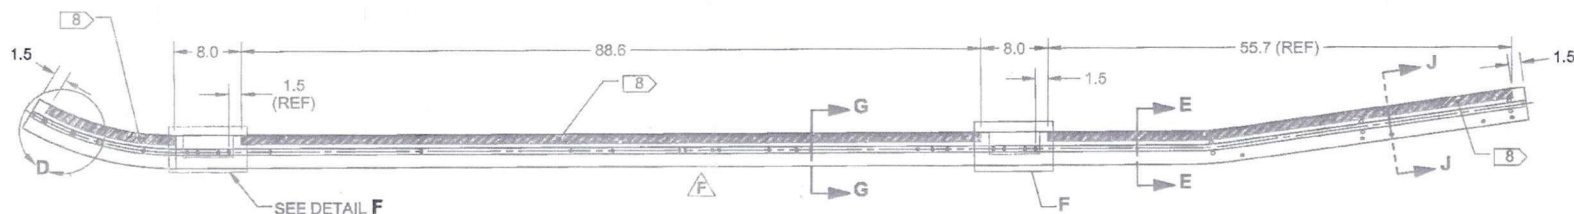

D3905-053 SKIDTUBE SUB ASSEMBLY

RELEASED
2018 OCT 19 4P

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PRIME (REF 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2.2.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50" ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 7 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

8

7

6


5

4


3

2


1

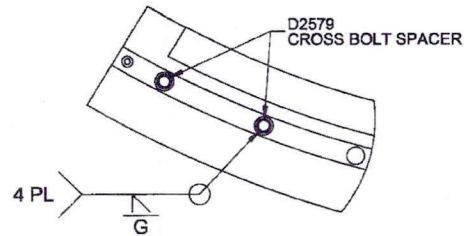


DETAIL D
SCALE: 3.5X

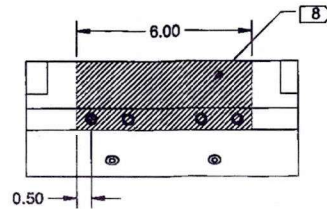


DETAIL F
SCALE: 3.5X

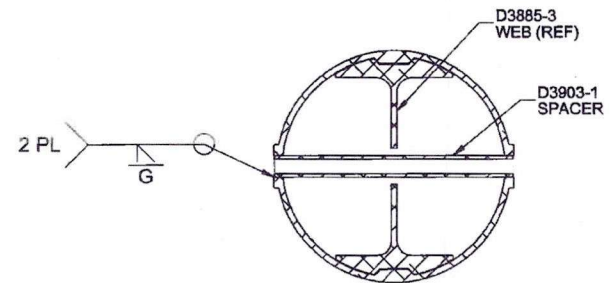


SECTION G-G
SCALE: 7X
12 PL

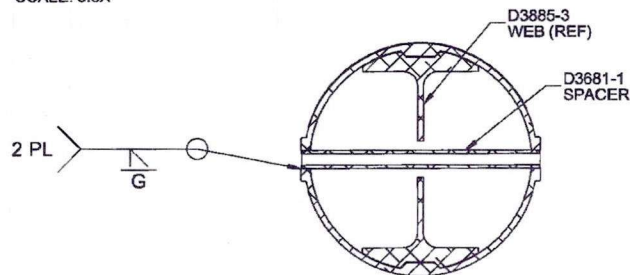

SECTION E-E
SCALE: 7X
12 PL

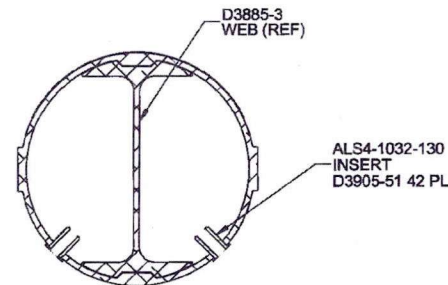

SECTION H-H
SCALE: 7X
D3905-51 21 PL

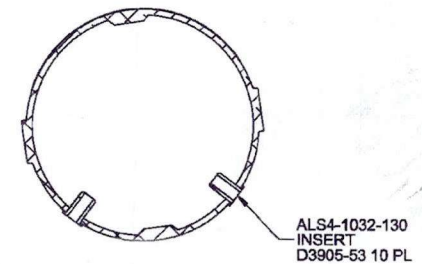

SECTION J-J
SCALE: 7X
D3905-53 5 PL

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PRIME (REF 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2.2.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) MASK THIS AREA AND DO NOT APPLY PRIMER OR PAINT
- 9) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION G-G $\phi 0.375$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.475 \times 45^\circ$
 - ii) INSERT D3903-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) C'BORE TO $\phi 0.313 \times 0.75$ DEEP
 - v) DEBURR HOLES
- 10) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION E-E $\phi 0.313$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.354 \times 45^\circ$ OR 0.050 DEEP $\times 45^\circ$ (BOTH SIDES)
 - ii) INSERT D3681-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) DEBURR HOLES
- 11) WELD PER DART QSI 004

RELEASED
2018 OCT 1 9 41

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 8 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR FOR REPRODUCTION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8

7

6

5

4

3

2

1

Entered: _____ Date: _____








WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -061	P/N	DESCRIPTION
	X	D3905-061	SKIDTUBE SUB ASSEMBLY
1	1	D3885-3	FLOAT WEB
2	1	D3905-11	SKIDTUBE

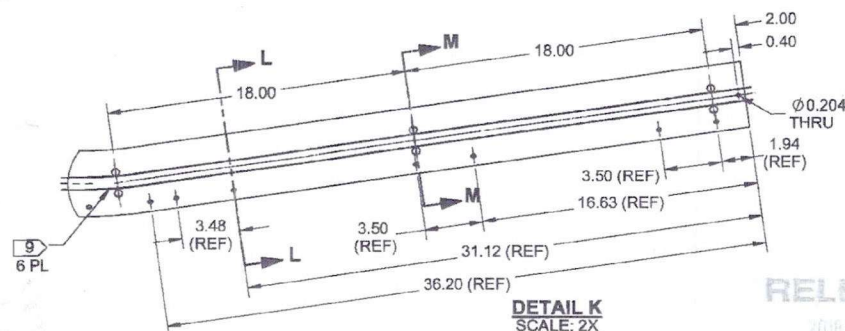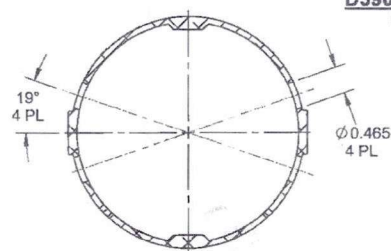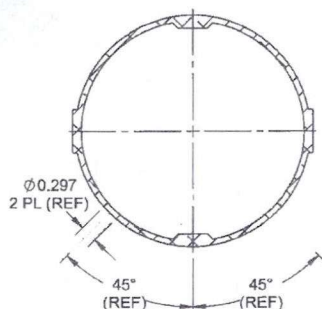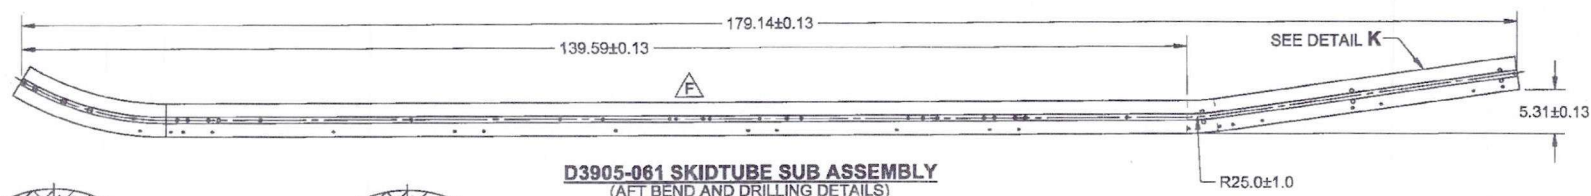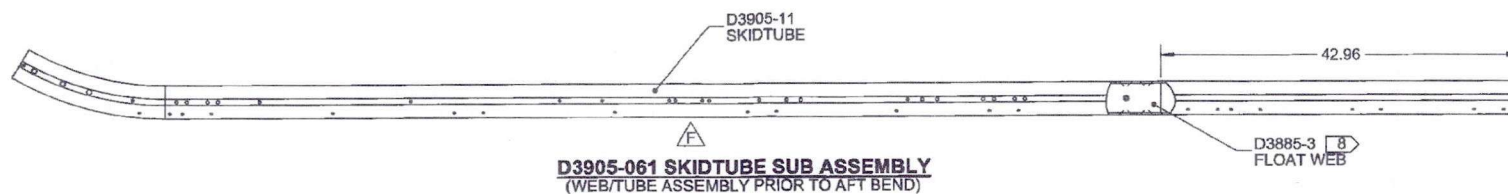

RELEASED
2016 OCT 19

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) INSERT D3885-3 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 AFTER BENDING. ENSURE HOLES LINE-UP
- 9) RELIEVE RIDGE FLUSH WITH SKIDTUBE FOR INSERT CLEARANCE, MAX 0.130 INTO RIDGE

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 9 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					


ITEM	QTY	P/N	DESCRIPTION
	X	D3905-063	SKIDTUBE SUB ASSEMBLY
1	1	D3885-3	FLOAT WEB
2	1	D3905-13	SKIDTUBE

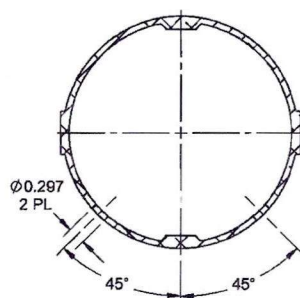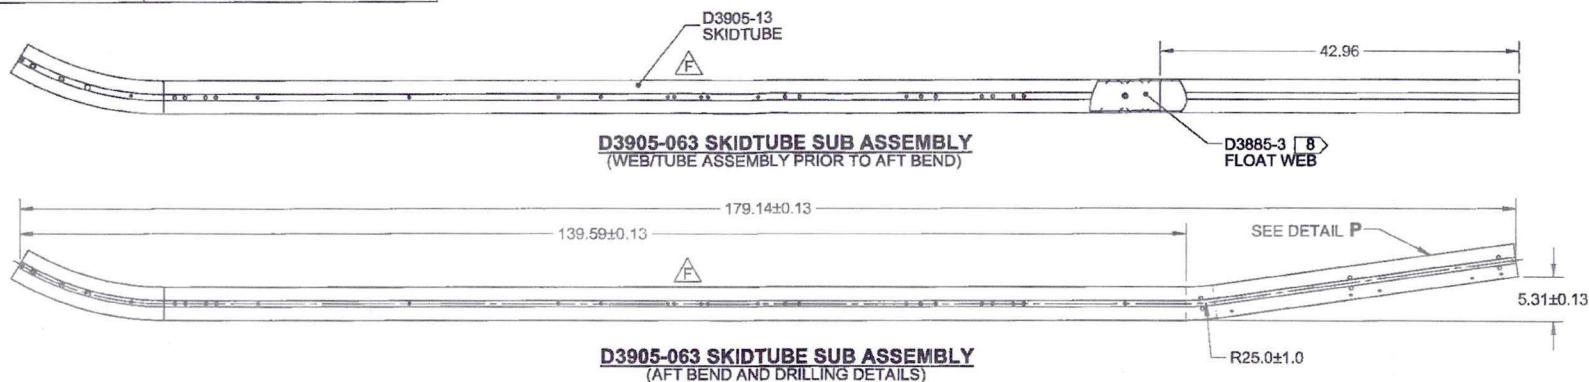

SECTION S-S
5 PL
SCALE: 7X

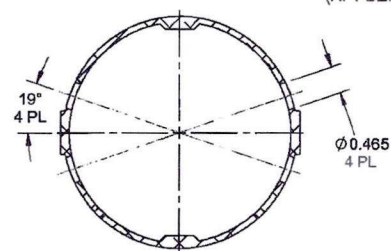

SECTION R-R
3 PL
SCALE: 7X

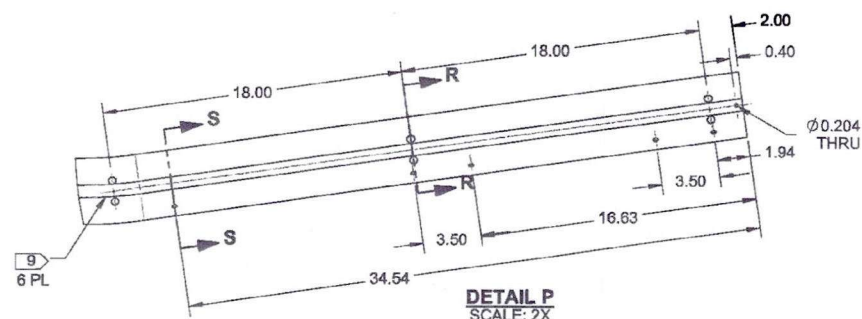

DETAIL P
SCALE: 2X

RELEASED

100 OCT 13 97

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) INSERT D3885-3 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 AFTER BENDING. ENSURE HOLES LINE-UP
- 9) RELIEVE RIDGE FLUSH WITH SKIDTUBE FOR INSERT CLEARANCE, MAX 0.130 INTO RIDGE

DESIGN		AJS	DART AEROSPACE USA, INC.	
DRAWN		ZF	EUGENE, OR	
CHECKED		MW	DRAWING NO.	REV. F
MFG. APPR.		DD	D3905	SHEET 10 OF 14
APPROVED		NO	TITLE	SCALE
DE APPR.		DS	A119 FLOAT SKIDTUBE ASSY NTS	
DATE		18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR REPRODUCTION OR TRANSMISSION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

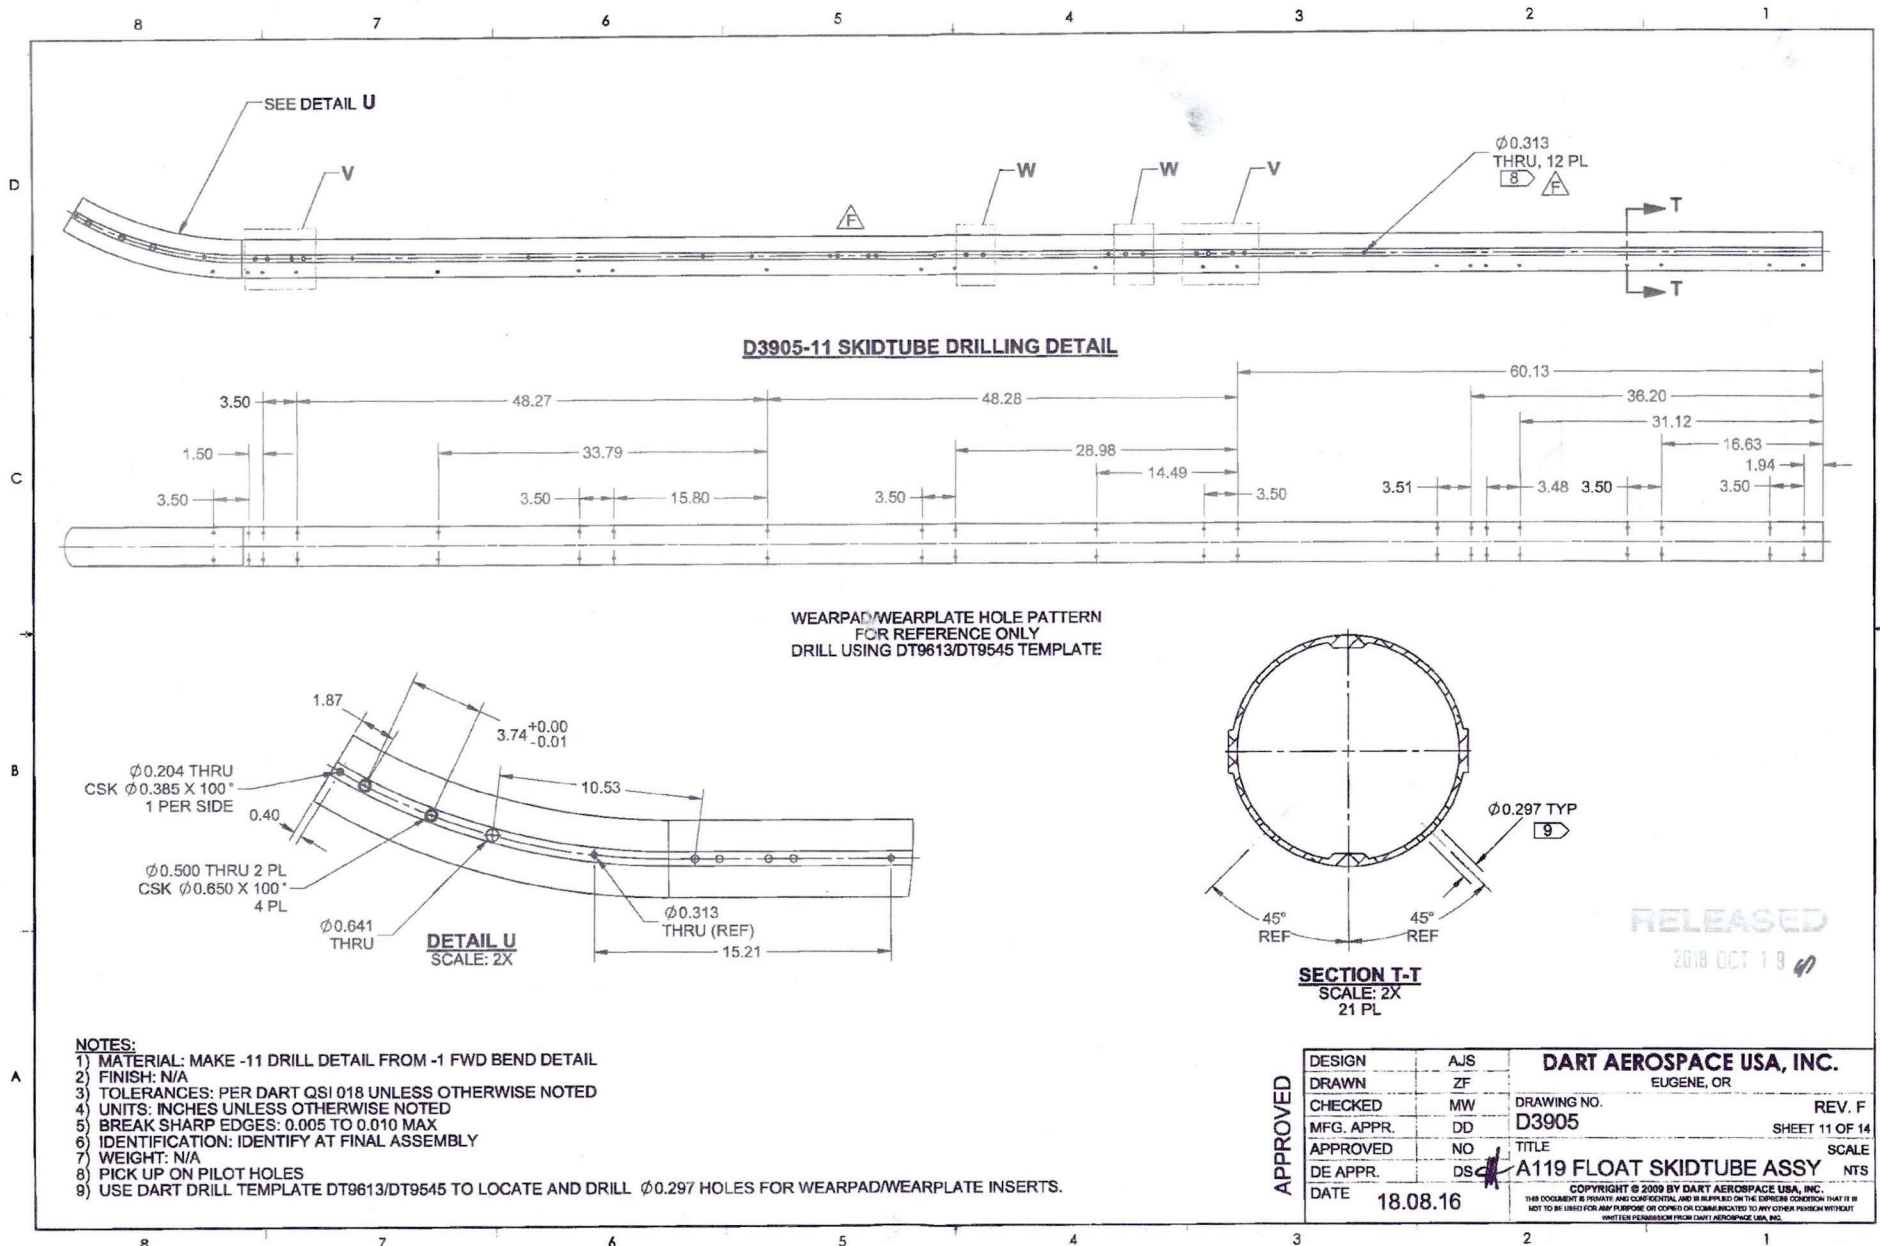

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

8 7 6 5 4 3 2 1

D

D

C


C

B


B

A


A

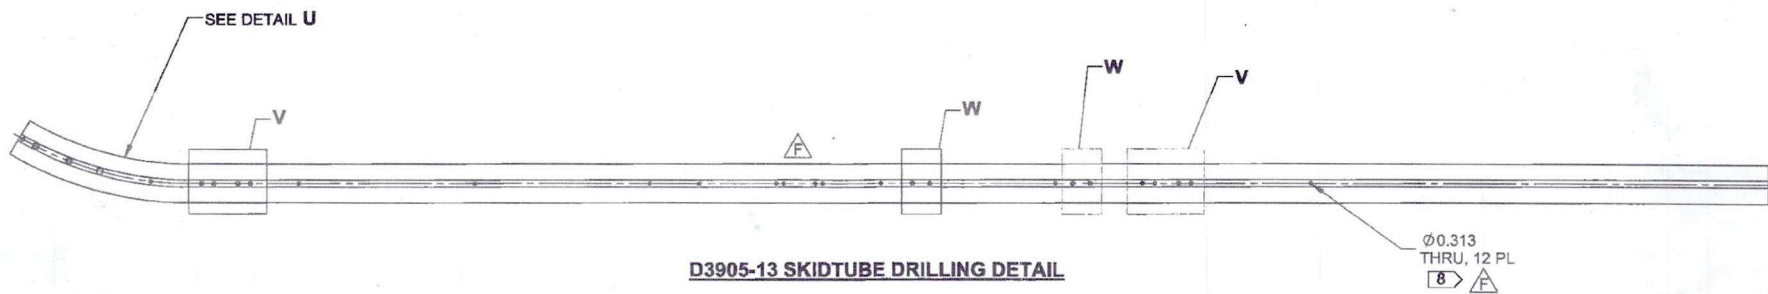

D3905-13 SKIDTUBE DRILLING DETAIL

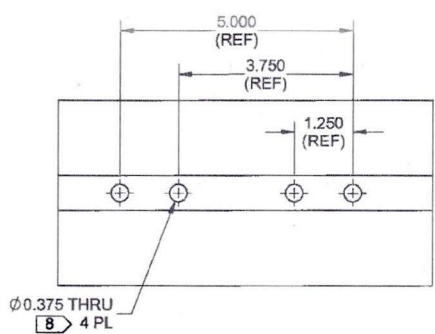

DETAIL V
SCALE 4X
2 PL

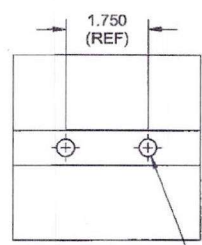

DETAIL W
SCALE 4X
2 PL

RELEASED
2018 OCT 19

NOTES:

- 1) MATERIAL: MAKE -13 DRILL DETAIL FROM -1 FWD BEND DETAIL
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) PICK UP ON PILOT HOLES

APPROVED

DESIGN	AJS
DRAWN	ZF
CHECKED	MW
MFG. APPR.	DD
APPROVED	NO
DE APPR.	DS
DATE	18.08.16

DART AEROSPACE USA, INC. EUGENE, OR	
DRAWING NO. D3905	REV. F
TITLE A119 FLOAT SKIDTUBE ASSY	SHEET 12 OF 14
DATE	SCALE
COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS RELEASED FOR THE CUSTOMER'S EXCLUSIVE USE ONLY. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

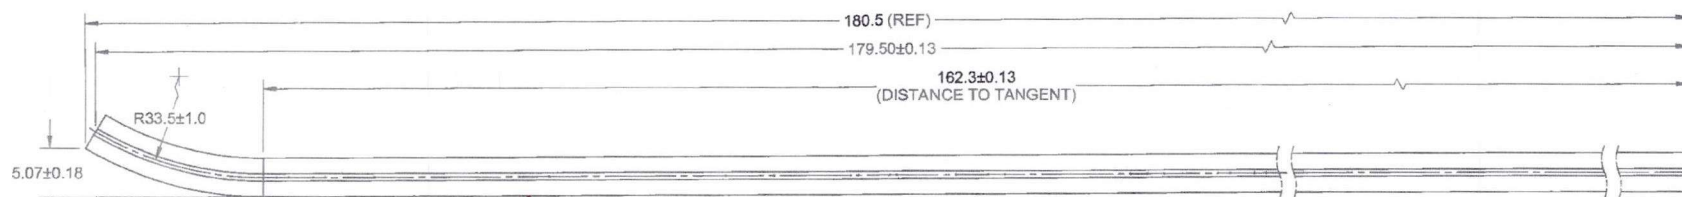

D3905-1 SKIDTUBE FWD BEND DETAIL

RELEASED
2018 OCT 19

NOTES:

- 1) MATERIAL: MAKE -1 FWD BEND DETAIL FROM -3 PILOT HOLE DETAIL
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 13 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042) _____	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					


8 7 6 5 4 3 2 1

D D


C C

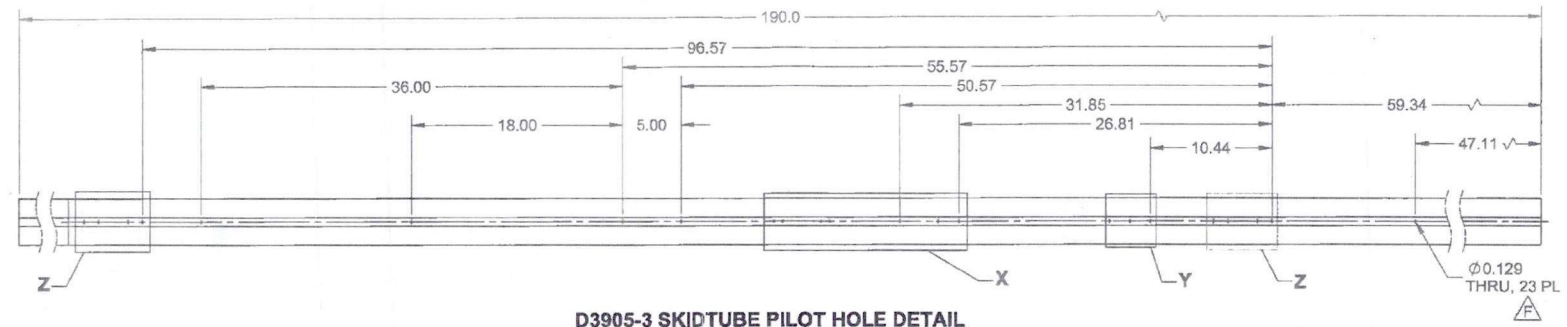


D3905-3 SKIDTUBE PILOT HOLE DETAIL

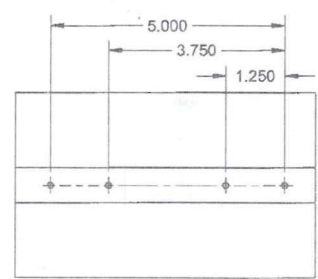

DETAIL Z
SCALE: 4X

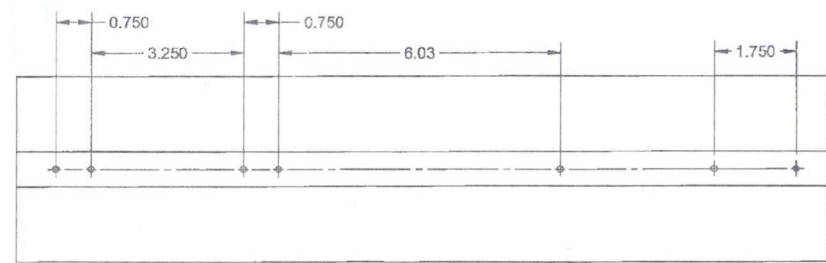

DETAIL X
SCALE: 4X

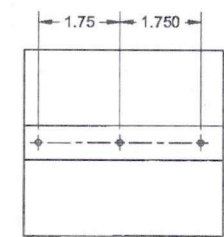

DETAIL Y
SCALE: 4X

B B

- NOTES:**
 1) MATERIAL: MAKE FROM D2500-1-190 EXTRUSION
 2) FINISH: N/A
 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
 7) WEIGHT: N/A

RELEASED
2008 OCT 19

APPROVED

DESIGN	AJS	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. F
MFG. APPR.	DD	D3905	SHEET 14 OF 14
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	A119 FLOAT SKIDTUBE ASSY	NTS
DATE	18.08.16	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

A A

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Eng. (Non-AW) ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Water Jet ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Supplier Quality ☐</td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐	Large Fab ☐	Finishing ☐	Rec/Store/Packaging ☐	Supplier Quality ☐																																
Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐																																														
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐																																														
Large Fab ☐	Finishing ☐	Rec/Store/Packaging ☐	Supplier Quality ☐																																														
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)																																													
Description Work Order Deviation			Disposition																																														
			Completed By																																														
			Lead hand / Supervisor																																														
			QC / QA Coordinator																																														
Root Cause <table style="width:100%;"> <tr><td>Operator</td><td>☐</td></tr> <tr><td>Manufacturing Process</td><td>☐</td></tr> <tr><td>Equip/Tooling</td><td>☐</td></tr> <tr><td>Handling/Preservation</td><td>☐</td></tr> <tr><td>Material</td><td>☐</td></tr> <tr><td>Product Improvement</td><td>☐</td></tr> <tr><td>Process Improvement</td><td>☐</td></tr> <tr><td>Human Factors</td><td>☐</td></tr> </table>		Operator	☐	Manufacturing Process	☐	Equip/Tooling	☐	Handling/Preservation	☐	Material	☐	Product Improvement	☐	Process Improvement	☐	Human Factors	☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>☐ Pressure/Forced</td> <td>☐ Contamination</td> <td>☐ Power Loss/Surge</td> <td>☐ Positioned Wrong</td> </tr> <tr> <td>☐ Bending</td> <td>☐ Misaligned/off center</td> <td>☐ Folio/Program</td> <td>☐ Outside Tolerance</td> </tr> <tr> <td>☐ Crushing</td> <td>☐ BOM/Route</td> <td>☐ Grain Direction</td> <td>☐ Drawing</td> </tr> <tr> <td>☐ Cracks</td> <td>☐ Broken/Damage/Defect</td> <td>☐ Weld</td> <td>☐ Finish</td> </tr> <tr> <td>☐ Crimp/Kink/Ripple/Wave/Twist</td> <td>☐ Incomplete/Unclear Instructions</td> <td>☐ Wrong Stock Pulled</td> <td>☐ Part Lost/Missing</td> </tr> <tr> <td>☐ Marks/Chatter</td> <td>☐ Drill Holes</td> <td>☐ Out of Sequence</td> <td>☐ Misread</td> </tr> <tr> <td>☐ Mislabeled</td> <td>☐ Fit/Function</td> <td>☐ Off-set/Set-up</td> <td></td> </tr> </table>				☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
Operator	☐																																																
Manufacturing Process	☐																																																
Equip/Tooling	☐																																																
Handling/Preservation	☐																																																
Material	☐																																																
Product Improvement	☐																																																
Process Improvement	☐																																																
Human Factors	☐																																																
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																														
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																														
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																														
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																														
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																														
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																														
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																															
Other/Details:																																																	